

NORLYS EGERSUND 1285


IP 65 | IK 08 | AC 220-240V 50-60Hz | LED | DIM

Egersund
1285XX0014
14.10.2026 v.14.6
www.norlys.no



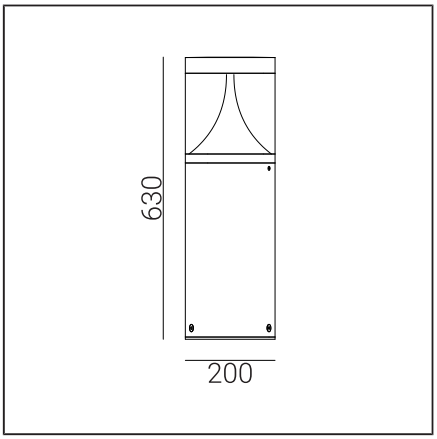

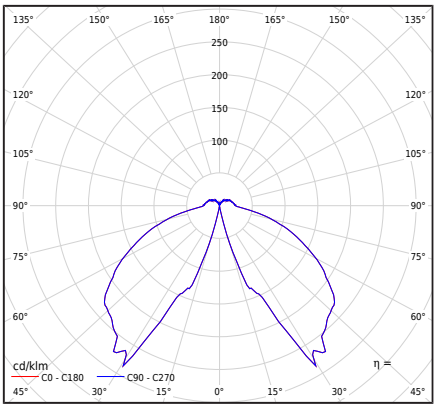

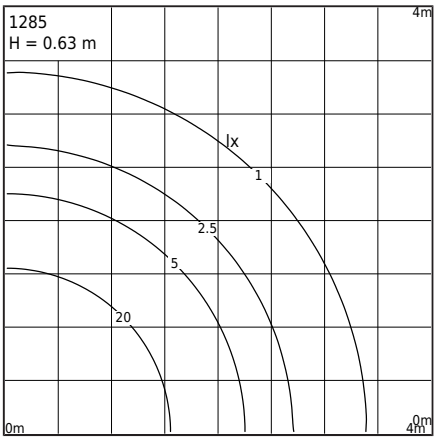

Type of luminaire

Type of luminaire	Post light fixture.
Photometric body	Light with rotationally symmetrical light distribution.
Characteristics of the luminaire	Luminaire with a contemporary design. For lighting gardens and other private and public areas

General information

Materials	Powder painted aluminum cast. Lens - transparent plastic PMMA. Silicone gasket. Nylon6 cable gland.
Mounting method	Mounting of the luminaire: 3 holes ø9mm on a diameter of ø65mm every 120° According to the attached assembly instructions Other accessories must be purchased separately
Terminal	Connection terminals: max 2x4mm² Possibility of connecting the luminaire in loops of max. 2x4mm² Round insulated cable with a diameter of ø8...17mm
Type of light source	LED module, electronic power supply Replaceable (LED only) light source by a professional. Replaceable control gear by a professional.
Light control	Phase-dimming (TRIAC) TRAILING EDGE (TE) - LEADING EDGE (LE)
Luminaire weight net / gross	7,72kg / 8,85kg
Box dimensions [cm]	23cm x 22cm x 68cm
Luminaire dimensions [cm]	20cm x 20cm x 63cm

Technical data

LED module	Cree DK201002 V1 JK3030 6V 3K (Datasheet)
Driver	Yes
Light source wattage	18W
Luminaire wattage	20,3W
Lamp luminous flux	2617lm
Luminaire luminous flux	1681lm
Efficiency of the luminaire	82,8lm/W
ULOR	9%
Color temperature	3000K
Colour consistency (McAdam ellipse)	SDCM3
Flicker of light (Pst LM)	≤1
Strobe effect (SVM)	≤0.4
Colour rendering index CRI	80
L80TM-21 [wg LM-80]	102 000h
L90 TM-21 [wg LM-80]	52 600h
Power Factor luminaire	PF 0,85
THD factor	10%
Ta Rated temperature	+25°C
Ambient operating temp. range	-20...+45°C

This product contains light source of energy efficiency class C / EPREL

Optionally, the luminaire is also available:
- In the safety class for KL I
- For LED color 2700K [1/1]
- For a different luminous flux value
- Version with surge protection device (SPD)
- For a different color of the luminaire (according to the RAL color palette)
- For a different luminaire height

Terms of sale and other information, after contact with the Norlys Sales Department

Inrush current	5A / 50µs
BUG rating	B1-U3-G1

Accessories sold separately

1231GA0009	Ground anchor
3087GA0009	Mounting adapter
1230ZX0009	Concreting anchor

Spare parts

ZS1285zx0014	Repair kit.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

TÜVRheinland CERTIFIED — Management System ISO 9001:2015 IATF 16949:2016 — www.tuv.com ID 9108651873

PCC Cert CERTIFICATE ISO 14001

RoHS 2011/65/UE

Before the assembly, read the instructions attached to the luminaire. Installation and service work is carried out by a person with appropriate authorizations and qualifications, in accordance with applicable regulations. Due to the dynamic development of lighting technology, we provide additional information on request.
Condensation that may occur in the luminaires is a natural phenomenon and does not affect the quality of the luminaire

NORLYS EGERSUND 1285



Egersund
1285XX0014
14.10.2026 v.14.6
www.norlys.no

Files to download

Manual	BIM Revit
BIM ArchiCAD	

Indexes

Index	Color	RAL
1285AL	ALUMINUM	9006
1285GR	GRAPHITE	7016

Other colors according to the "Colors Template" / RAL pattern book - available on request, subject to agreement with Norlys' Sales Department.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

Management System ISO 9001:2015 IATF 16949:2016
TÜVRheinland CERTIFIED
www.tuv.com ID 9108651873
PCC Cert CERTIFICATE ISO 14001
RoHS 2011/65/UE

Before the assembly, read the instructions attached to the luminaire. Installation and service work is carried out by a person with appropriate authorizations and qualifications, in accordance with applicable regulations. Due to the dynamic development of lighting technology, we provide additional information on request.
Condensation that may occur in the luminaires is a natural phenomenon and does not affect the quality of the luminaire