

NORLYS ASKER PRO 1317


AC 220-240V 50-60Hz | IP 65 | IK 08 | LED | DALI2 TD

Asker pro 1317XX0011
21.09.2026 v.11.14
www.norlys.no



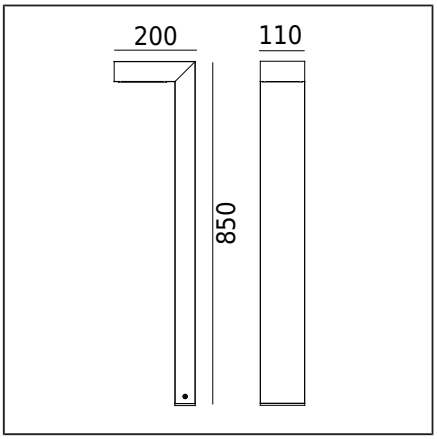

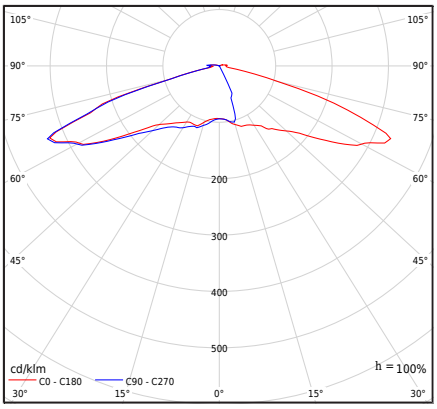

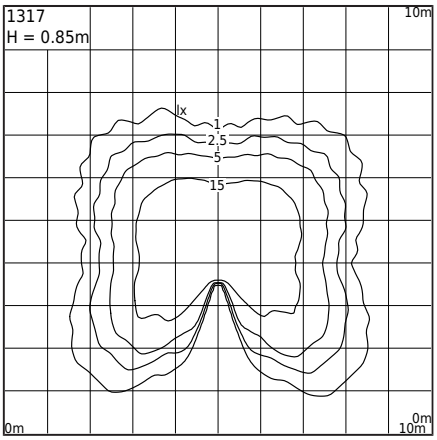

Type of luminaire

Type of luminaire	Post light fixture.
Photometric body	Lens from Ledil type VSM (IESNA type V)
Characteristics of the luminaire	A fixture with contemporary design. For illuminating gardens, private areas, and other architectural solutions.

General information

Materials	Powder painted aluminum cast. The outer hermetic lens - transparent PMMA plastic Silicone gasket. EPDM cable gland.
Mounting method	Fixture mounting: 4 holes ø8mm, spacing 18x50mm.
Terminal	Connection terminals: max 5x2.5mm², possibility of looping the fixture: max 5x1.5mm². Round rubber cable with a diameter of max ø12.5mm.
Type of light source	LED module, DALI / TD electronic power supply Replaceable (LED only) light source by a professional. Replaceable control gear by a professional.
Light control	Light control in the system: DALI2/TD.
Luminaire weight net / gross	4,01kg / 4,36kg
Box dimensions [cm]	88cm x 23cm x 13cm
Luminaire dimensions [cm]	85cm x 20cm x 11cm

Technical data

LED module	Cree DK200402 V1 XTE-HE 3K (Datasheet)
Driver	Yes
Driver durability	100000h
External control	DALI2-TD (User manual)
Light source wattage	5,8W
Luminaire wattage	7,9W
Stanby power (Psb)	< 0,45W
Lamp luminous flux	828lm
Luminaire luminous flux	599lm
Efficiency of the luminaire	75,8lm/W
ULOR	2%
Color temperature	3000K
Colour consistency (McAdam ellipse)	SDCM3
Flicker of light (Pst LM)	≤1
Strobe effect (SVM)	≤0.4
Colour rendering index CRI	80
L90 TM-21 [wg LM-80]	>109 000h
LED photobiological threat	RG0 or RG1
Power Factor luminaire	PF > 0,95
THD factor	< 11%
Ta Rated temperature	+25°C
Ambient operating temp. range	-20...+50°C

This product contains light source of energy efficiency class F / EPREL

The option to install a different type of lenses. Delivery time is subject to agreement with the Sales Department of Norlys Sp. z o.o.

Inrush current	10.1A / 16µs
BUG rating	B1-U1-G1

Maximum number of luminaires of this type per MCB:

B 10A: 30, B 16A: 49, C 10A: 49, C 16A: 79

Accessories sold separately

1907ZX0009	Concreting anchor
3090GA0009	Mounting adapter
1909GA0010	Adapter for concrete foundation
3081XX0009	Mounting adapter
1908GA0009	Ground anchor

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

TÜVRheinland CERTIFIED — Management System ISO 9001:2015 IATF 16949:2016 — www.tuv.com ID 9108651873

PCC Cert CERTIFICATE ISO 14001

RoHS 2011/65/UE

Before starting the assembly, read the instructions attached to the fixture. Installation and service work must be conducted by a person with appropriate authorizations and qualifications, in accordance with applicable regulations. Due to the dynamic development of lighting technology, additional information is provided at the customer's request. Condensation that may occur in fixtures is a natural phenomenon and does not affect the deterioration of the fixture's quality.

ASKER PRO 1317

Spare parts

99zx0009	Maintenance kit for lighting fixtures
ZN1317xx0011	Service set.

Files to download

Photometric LDT files	Photometric IES files
Manual	BIM Revit
BIM ArchiCAD	

Indexes

Index	Color	RAL
1317AL	ALUMINUM	9006
1317BL	BLACK	9005
1317GR	GRAPHITE	7016

Other colors according to the "Colors Template" / RAL pattern book - available on request, subject to agreement with Norlys' Sales Department.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

Management System ISO 9001:2015 IATF 16949:2016
www.tuv.com ID 9108651873
CERTIFICATE ISO 14001
RoHS 2011/65/UE

Before starting the assembly, read the instructions attached to the fixture. Installation and service work must be conducted by a person with appropriate authorizations and qualifications, in accordance with applicable regulations. Due to the dynamic development of lighting technology, additional information is provided at the customer's request. Condensation that may occur in fixtures is a natural phenomenon and does not affect the deterioration of the fixture's quality.