

NORLYS MOLDE 1972

IP 54 | IK 07 | AC 220-240V 50-60Hz | LED | No Dim

Molde 1972XX0009
02.11.2026 v.09.31
www.norlys.no



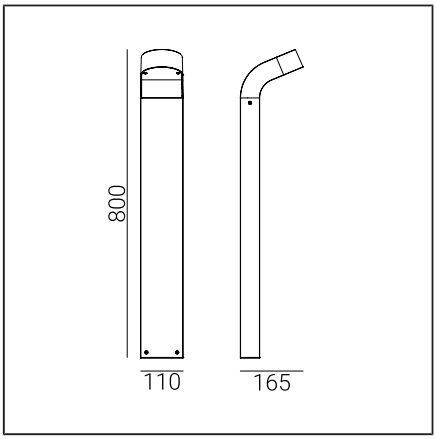

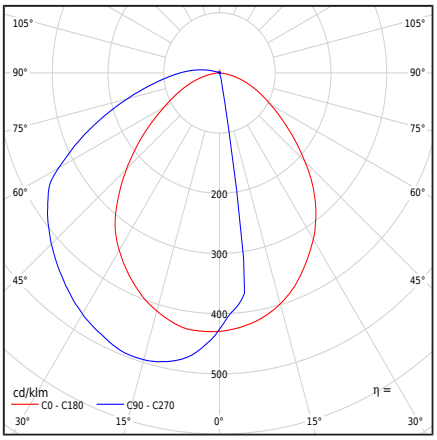

Type of luminaire

Type of luminaire	Post light fixture.
Photometric body	Diffused light, covered from the top.
Characteristics of the luminaire	Luminaire with a contemporary design For lighting private areas, parks and other architectural concepts

General information

Materials	Powder painted aluminum cast. Lens - transparent polycarbonate with structure, UV stabilized.
Mounting method	Fixture mounting: 4 holes ø7mm spaced 18x50mm. According to the included assembly instructions. Additional accessories must be purchased separately.
Terminal	Connection terminals: max 4x4mm², possibility of connecting the fixture in a loop max 4x2.5mm². Cord with a round jacket diameter: ø4...8mm, ø8...12mm or ø10...13.6mm.
Type of light source	AC integrated LED module, PIR motion detector Replaceable (LED only) light source by a professional.
Light control	Luminaire equipped with a PIR motion sensor, with a dusk switch and motion hold. Programmed for: maximum range of operation, lighting time 1 minute, twilight 10lux.
Luminaire weight net / gross	2kg / 2,39kg
Box dimensions [cm]	82cm x 17cm x 12cm
Luminaire dimensions [cm]	80cm x 16,5cm x 11cm

Technical data

LED module	Lumens EDC 57C 8W xxx 230V F201 4K (Datasheet)
External control	ESYLUX PIR Motion Sensor MD-C 360I/6 mini (User manual)
Light source wattage	8W
Luminaire wattage	8,2W
Lamp luminous flux	772lm
Luminaire luminous flux	438lm
Efficiency of the luminaire	53,4lm/W
ULOR	2%
Color temperature	4000K
Colour consistency (McAdam ellipse)	SDCM3
Colour rendering index CRI	80
Power Factor luminaire	PF0,95
Ta Rated temperature	+25°C
Ambient operating temp. range	-20...+45°C

This product contains light source of energy efficiency class E / EPREL

Optionally, the luminaire is also available:
- For LED color 2700K [1/1]
- For a different color of the luminaire (according to the RAL color palette)
- For a different height of the luminaire (not less than 55cm)

Terms of sale and other information, after contact with the Norlys Sales Department

Inrush current	35mA / 60ms
BUG rating	"B0-U1-G0"

Accessories sold separately

1907ZX0009	Concreting anchor
3090GA0009	Mounting adapter
1909GA0010	Adapter for concrete foundation
3081XX0009	Mounting adapter
1906ZX0009	Mounting adapter
1908GA0009	Ground anchor

Spare parts

ZS PIR 0919720001	Repair kit.
ZS1972zx0009	Repair kit.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no


TÜVRheinland CERTIFIED — Management System ISO 9001:2015 IATF 16949:2016 — www.tuv.com ID 9108651873

PCC cert CERTIFICATE ISO 14001

RoHS 2011/65/UE

Before the assembly, read the instructions attached to the luminaire. Installation and service work is carried out by a person with appropriate authorizations and qualifications, in accordance with applicable regulations. Due to the dynamic development of lighting technology, we provide additional information on request.
Condensation that may occur in the luminaires is a natural phenomenon and does not affect the quality of the luminaire

MOLDE 1972



Files to download

Photometric LDT files	Photometric IES files
Manual	

Indexes

Index	Color	RAL
1972AL	ALUMINUM	9006
1972GR	GRAPHITE	7016

Other colors according to the "Colors Template" / RAL pattern book - available on request, subject to agreement with Norlys' Sales Department.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

TÜVRheinland CERTIFIED
Management System ISO 9001:2015 IATF 16949:2016
www.tuv.com ID 9108651873
PCC Cert CERTIFICATE ISO 14001
RoHS 2011/65/UE

Before the assembly, read the instructions attached to the luminaire. Installation and service work is carried out by a person with appropriate authorizations and qualifications, in accordance with applicable regulations. Due to the dynamic development of lighting technology, we provide additional information on request.
Condensation that may occur in the luminaires is a natural phenomenon and does not affect the quality of the luminaire