
# NORLYS MODENA 351

AC 220-240V 50-60Hz | IP 54 | E27

Modena 351XX0010
16.09.2026 v.10.7
www.norlys.no



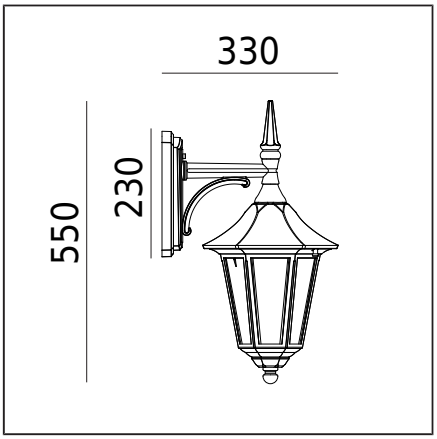


## Type of luminaire

| | |
|---|---|
| Type of luminaire | Wall light, |
| Photometric body | Light discovered |
| Characteristics of the luminaire | Classic type, wall-mounted luminaire for general use. Possibility to install on corners of architectural objects. |

## General information

| | |
|---|---|
| Materials | Powder painted aluminum cast. Lens - clear polycarbonate, UV stabilized. EPDM cable gland. |
| Mounting method | Fixing of the luminaire: 4 holes ø5mm, spacing 25x140mm. |
| Terminal | Connection terminals: max 2x2,5mm². A round wire in the isolation with a diameter of ø7...10,5mm. |
| Type of light source | Lamp E27 A55...A60<br>Replaceable light source by an end-user. |
| Luminaire weight net / gross | 2kg / 2,6kg |
| Box dimensions [cm] | 43,5cm x 29cm x 24cm |

## Technical data

| | |
|---|---|
| Lamp E27 | LED A55..60 |
| Light source wattage | LED max 9W |
| Ta Rated temperature | +25°C |
| Ambient operating temp. range | -20...+45°C |

Possibility to order the fixture with an LED lamp E27 type Philips Master LEDbulb 806lm/8.5W/2700K (dimmable).

## Accessories sold separately

| | |
|---|---|
| 152XX0009 | Corner bracket |

## Spare parts

| | |
|---|---|
| 06350004 | Lampshade - service kit |

## Files to download

Manual

## Indexes

| Index | Color | RAL |
|---|---|---|
| 351BL | BLACK | 9005 |
| 351WH | WHITE | 9003 |

Other colors according to the "Colors Template" pattern book - available on request, subject to agreement with Norlys' Sales Department.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

TÜVRheinland CERTIFIED
Management System ISO 9001:2015 IATF 16949:2016
www.tuv.com ID 9108651873

PCC Cert CERTIFICATE ISO 14001

RoHS 2011/65/UE

Please read the manual before installing. Due to the dynamic development of lighting technology, additional information is available upon request. LED module must be replaced by a qualified person in accordance with
applicable regulations. Condensation, which can occur in luminaires, is a natural phenomenon and does not
impair the quality of the luminaire.