

NORLYS ASKER HEAD 4382


AC 220-240V 50-60Hz | IP 65 | IK 10 | LED | DALI2

ASKER HEAD
4382XX0309
16.09.2026 v.09.9
www.norlys.no



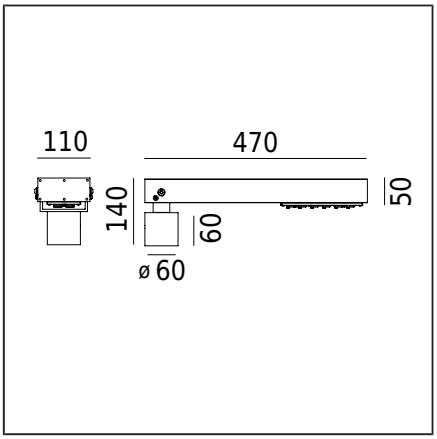

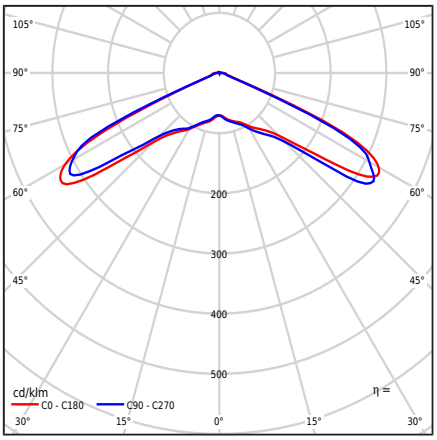

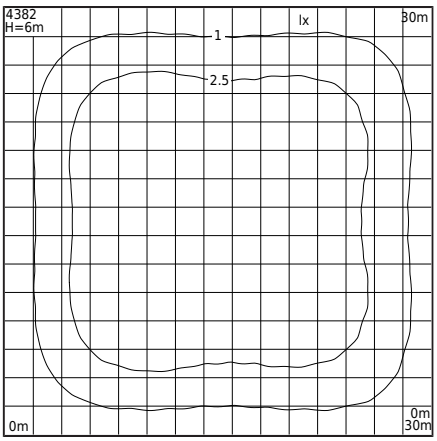

Type of luminaire

Type of luminaire	Pole luminaire.
Photometric body	Lens from Ledil type VSM (IESNA type V)
Characteristics of the luminaire	Post-top luminaire, designed for installation on a lighting pole with a Ø60mm mounting stem. Wide, even light distribution. Luminaire also adapted for direct current voltage: DC 168 ÷ 275 V

General information

Materials	Extruded aluminum profile, powder coated. Hermetic external lens - transparent PC plastic.
Mounting method	Fixture mounting: the fixture is designed for a Ø 60 pole according to the installation instructions. Set components: art.7711 - Ø60 bracket art.4306 - fixture
Terminal	The fixture is equipped with a H05BQ-F 5G1 type cable, 6m in length. For connection in a suitably chosen electrical installation box.
Type of light source	Optical kit with IP67 (LED module and lens); electronic power supply Replaceable (LED only) light source by a professional. Replaceable control gear by a professional.
Light control	System light control: DALI outdoor full programm. The power supply is programmed for the maximum permitted current. Programming of other parameters after contact with the Norlys Sales Department.
Luminaire weight net / gross	2,8kg / 3,2kg
Box dimensions [cm]	50,5cm x 12,5cm x 8,5cm
Luminaire dimensions [cm]	47cm x 11cm x 7cm

Technical data

LED module	Philips Fortimo FastFlex LED 2x6 DP G5 3K (Datasheet)
Driver	Yes
Driver durability	100000h
External control	DALI2 / NightDim (XI FP NLD) (User manual)
Light source wattage	16,8W
Luminaire wattage	19,6W
Lamp luminous flux	2904lm
Luminaire luminous flux	2711lm
Efficiency of the luminaire	138,3lm/W
ULOR	0,8%
Color temperature	3000K
Colour consistency (McAdam ellipse)	SDCM5
Colour rendering index CRI	70
L90B10 [wg LM-80]	>100 000h
Power Factor luminaire	PF 0,98
Ta Rated temperature	+25°C
Ambient operating temp. range	-20...+45°C
This product contains light source of energy efficiency class D / EPREL	
BUG rating	B2-U2-G1

Accessories sold separately

7711XX0009	Mounting adapter
7712XX0009	Mounting adapter

Files to download

Photometric LDT files	Photometric IES files
Manual	

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

TÜVRheinland CERTIFIED — Management System ISO 9001:2015 IATF 16949:2016 — www.tuv.com ID 9108651873

PCC cert CERTIFICATE ISO 14001

RoHS 2011/65/UE

Before starting installation, please read the instructions attached to the fixture.
Installation and service work should be performed by a person with the appropriate authorizations and qualifications, in accordance with current regulations.
Due to the dynamic development of lighting technology, additional information will be provided upon customer request.
LED module replaceable by a person with the appropriate qualifications, in accordance with current regulations.
Condensation that may occur in fixtures is a natural phenomenon and does not affect the deterioration of the quality of the fixture.

ASKER HEAD 4382



Indexes

Index	Color	RAL
4382AL	ALUMINUM	9006
4382BL	BLACK	9005
4382GR	GRAPHITE	7016

Other colors according to the "Colors Template" pattern book - available on request, subject to agreement with Norlys' Sales Department.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

TÜVRheinland CERTIFIED
Management System
ISO 9001:2015
IATF 16949:2016
www.tuv.com
ID 9108651873

PCC Cert
CERTIFICATE
ISO 14001

RoHS 2011/65/UE

Before starting installation, please read the instructions attached to the fixture.
Installation and service work should be performed by a person with the appropriate authorizations and qualifications, in accordance with current regulations.
Due to the dynamic development of lighting technology, additional information will be provided upon customer request.
LED module replaceable by a person with the appropriate qualifications, in accordance with current regulations.
Condensation that may occur in fixtures is a natural phenomenon and does not affect the deterioration of the quality of the fixture.