


# NORLYS VARBERG 7153

Varberg 7153XX0009
24.11.2026 v.09.9
www.norlys.no

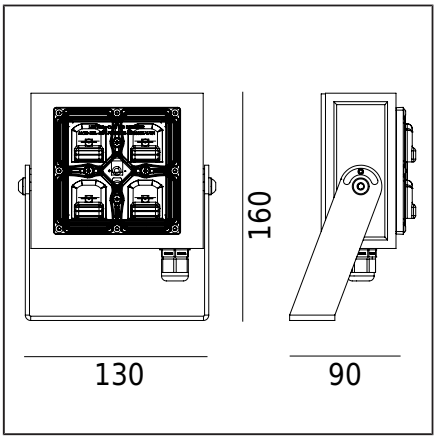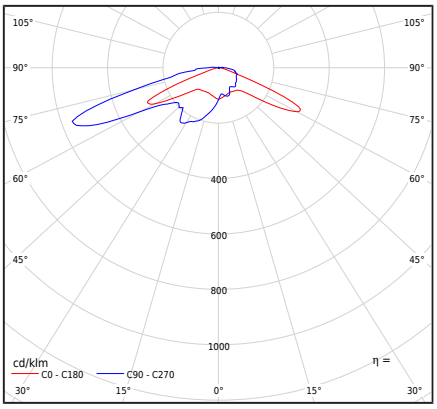

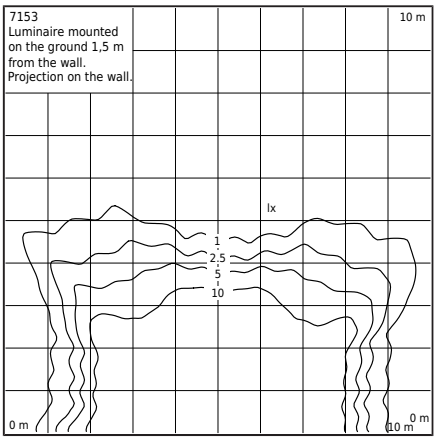


## Type of luminaire

| | |
|---|---|
| Type of luminaire | Floodlight luminaire |
| Photometric body | Lens from Ledil type T4-B (IESNA type IV) |
| Characteristics of the luminaire | For illuminating building facades, gardens, private areas, and other architectural concepts. The ability to adjust the direction of lighting also in the vertical plane. |

## General information

| | |
|---|---|
| Materials | Extruded aluminum profile, powder coated. Hermetic external lens - transparent PC plastic. Nickel-plated brass cable gland. |
| Mounting method | Luminaire mounting: 2 holes Ø 7 mm spacing 90 mm<br>According to the attached installation instructions. |
| Terminal | The luminaire is equipped with an H05RN-F 5G1 type cable<br>To be connected in a suitably selected electrical junction box. |
| Type of light source | LED module, electronic power supply<br>Replaceable (LED only) light source by a professional.<br>Replaceable control gear by a professional. |
| Light control | Light control - DALI system |
| Luminaire weight net / gross | 0,9kg / 1,03kg |
| Box dimensions [cm] | 18,5cm x 17cm x 10cm |
| Luminaire dimensions [cm] | 13cm x 16cm x 9cm |

## Technical data

| | |
|---|---|
| LED module | Cree DK200402 V1 XTE-HE 3K (Datasheet) |
| Driver | Yes |
| Driver durability | 100000h |
| Luminaire wattage | 7,8W |
| Luminaire luminous flux | 742lm |
| Efficiency of the luminaire | 95,1lm/W |
| Color temperature | 3000K |
| Colour consistency (McAdam ellipse) | SDCM3 |
| Flicker of light (Pst LM) | ≤1 |
| Strobe effect (SVM) | ≤0.4 |
| Colour rendering index CRI | 80 |
| L90 TM-21 [wg LM-80] | >109 000h |
| LED photobiological threat | RG1 |
| Power Factor luminaire | PF>0,95 |
| THD factor | <10% |
| Ta Rated temperature | +25°C |
| Ambient operating temp. range | -20...+45°C |

This product contains light source of energy efficiency class A G / EPREL

Optionally, the luminaire is also available:
- for a different luminaire color (according to the RAL color palette)
- the possibility of mounting a different type of lenses.
Terms of sale and additional information can be agreed upon with the Norlys Sales Department.

| | |
|---|---|
| Inrush current | 5A / 220µs |
| BUG rating | B1-U1-G1 |

Maximum number of luminaires of this type per MCB:

B 10A: 82, B 16A: 130

## Accessories sold separately

| | |
|---|---|
| 104ZX0009 | Ground spike |

## Files to download

| | |
|---|---|
| Photometric LDT files | Photometric IES files |
| Manual | |


Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no



TÜVRheinland CERTIFIED
Management System ISO 9001:2015 IATF 16949:2016
www.tuv.com ID 9108651873

PCC Cert CERTIFICATE ISO 14001

RoHS 2011/65/UE


Before starting the installation, it is necessary to read the instructions attached to the fixture. Due to the dynamic development of lighting technology, additional information is provided upon customer request. Replacement of the LED module is only possible by Norlys professional service. Condensation that may occur in the fixtures is a natural phenomenon and does not affect the deterioration of the quality of the fixture.

# VARBERG 7153



## Indexes

| Index | Color | RAL |
|---|---|---|
| 7153AL | ALUMINUM | 9006 |
| 7153BL | BLACK | 9005 |
| 7153GR | GRAPHITE | 7016 |

Other colors according to the "Colors Template" / RAL pattern book - available on request, subject to agreement with Norlys' Sales Department.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

Management System ISO 9001:2015 IATF 16949:2016
www.tuv.com ID 9108651873
CERTIFICATE ISO 14001
RoHS 2011/65/UE

Before starting the installation, it is necessary to read the instructions attached to the fixture. Due to the dynamic development of lighting technology, additional information is provided upon customer request. Replacement of the LED module is only possible by Norlys professional service. Condensation that may occur in the fixtures is a natural phenomenon and does not affect the deterioration of the quality of the fixture.