

NORLYS KOSTER 724


AC 220-240V 50-60Hz | IP 54 | IK 10 | E27

Koster 724XX0010
16.09.2026 v.10.8
www.norlys.no



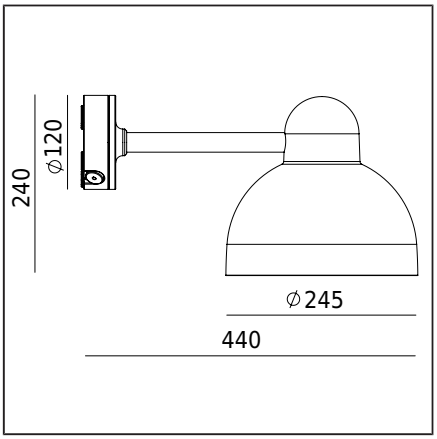

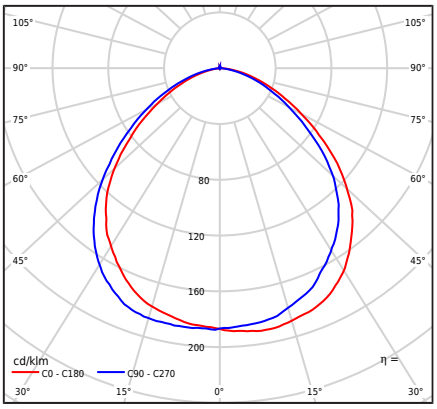

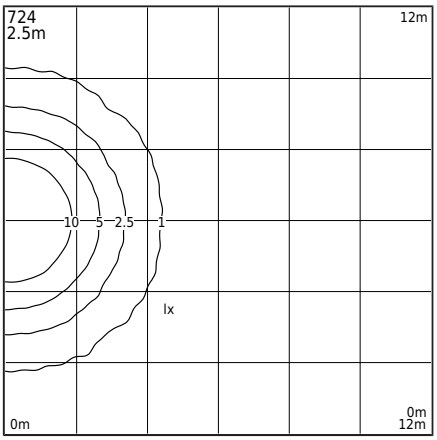

Type of luminaire

Type of luminaire	Wall light,
Photometric body	Single-sided light: symmetrical, directed downward.
Characteristics of the luminaire	Modern design wall-mounted luminaire. Possibility to install on corners of architectural objects.

General information

Materials	Powder painted aluminum cast. Lens - transparent polycarbonate with structure, UV stabilized. Silicone gasket. EPDM cable gland.
Mounting method	Fixing of the luminaire: 3 holes ø7mm, spacing according to the attached mounting box.
Terminal	Connection terminals: max 3x2,5mm², possibility to connect luminaire in loop max 3x1,5mm². A round wire in the isolation with a diameter of ø7...10,5mm.
Type of light source	Lamp E27 A55...A60 Replaceable light source by an end-user.
Luminaire weight net / gross	2,74kg / 3,61kg
Box dimensions [cm]	43,5cm x 29cm x 24cm

Technical data

Lamp E27	LED A55..60
Light source wattage	LED max 9W
Luminaire wattage	LED max 9W
ULOR	0%
Ta Rated temperature	+25°C
Ambient operating temp. range	-20...+45°C

Spare parts

06710000	Lampshade - service kit

Files to download

Photometric LDT files	Photometric IES files
Manual	BIM Revit
BIM ArchiCAD	

Indexes

Index	Color	RAL
724AL	ALUMINUM	9006
724GR	GRAPHITE	7016

Other colors according to the "Colors Template" pattern book - available on request, subject to agreement with Norlys' Sales Department.

Norlys AS
P.B 1014 Hoff, 0218
Oslo
Hovfaret 4B, 0275
Oslo
Norway
+47 24 12 40 11
firmapost@norlys.no

TÜVRheinland CERTIFIED — Management System ISO 9001:2015 IATF 16949:2016 — www.tuv.com ID 9108651873

PCC cert CERTIFICATE ISO 14001

RoHS 2011/65/UE

Please read the manual before installing. Due to the dynamic development of lighting technology, additional information is available upon request. LED module must be replaced by a qualified person in accordance with applicable regulations. Condensation, which can occur in luminaires, is a natural phenomenon and does not impair the quality of the luminaire.